

KTI Networks Important Notice

May 28, 2008

PRODUCT

KGS-510F


FIRMWARE

Ver.**1.24** or 1.2x earlier (the version series without 802.1x function)

Ver.**1.35** or 1.3x earlier (the version series with 802.1x function)

PROBLEM

As two scenarios shown below, the Windows PC is unable to manage the Switch M via web browser or ping the Switch M through the Switch N if the Mac address M is within the range of N and N+6.

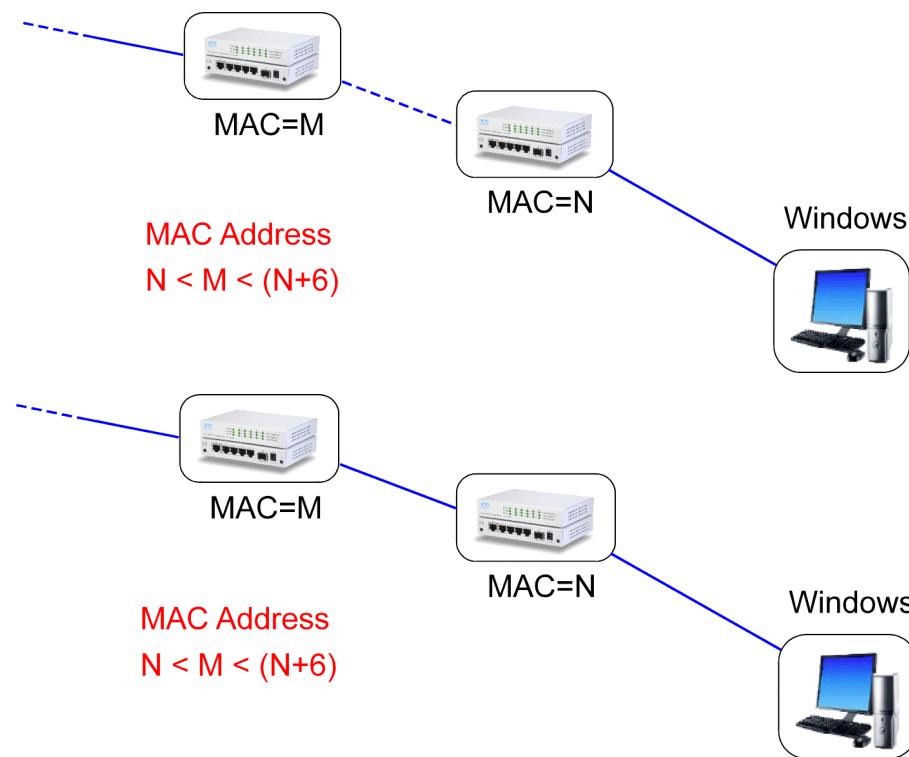

In both scenarios, the packet switching function on the Switch M and Switch N are with no problem but only management function.

SOLUTION

Update the firmware v1.24 of the Switch N with firmware **Ver.1.25**.

Update the firmware v1.35 of the Switch N with firmware **Ver.1.36**.